ShangHai Orient Intertek Testing Service - INSPECTION DIRECT FAX NO.: (86-21) 53397745 TEL. NO.: (86-21) 53397600 Total Quality. Assured.

TO :DEUBA BMBH & CO KG - MARGARITA WANG/KRAUS/ALINA LI/DANIEL BEHRENS/UDO SCHAFER C.C. : INTERTEK CONSUMER GOODS GMBH - GREY BAXTER

NUMBER: SHIJ894611 (1ST REVISED) THIS IS TO SUPERSEDE REPORT SHIJ894611 DATED SEP 10, 2020

INSPECTION REPORT

DATE: Sep 10,2020

APPLICANT: **DEUBA BMBH & CO KG ZUMA WIESENHOF 84** 66663MERZIG GERMANY ATTN .: UDO SCHAFER



PRODUCT (ASSEMBLED)

UNIT PACKING

DESCRIPTION BUYER SUPPLIER FACTORY NAME FACTORY ADDRESS ORDER NO. MODEL NO./STYLE NO. SUPPLIER ART. NO. COLOB	 big play kitchen/small play kitchen DEUBA BMBH & CO KG DEUBA BMBH & CO KG ZHEJIANG TAISHUN ZHENXING TOYS CO.,LTD. JIAOYANG INDUSTRIAL PARK, TAISHUN COUNTY, WENZHOU CITY, ZHEJIANG PROVINCE DB8430001/DB8430002 108639/108640 TZ-D6010/TZ-D6011BA
COLOR	:
DATE OF INSPECTION PLACE OF INSPECTION	: Sep 08,2020 to Sep 09,2020 : CHINA(TAISHUN,WENHOU,ZHEJIANG)

FULL NAME OF INSPECTOR(S) : Jacey Chen

CONCLUSION:

[X] Combine items sampling inspection

"Per the Client's request, Intertek has performed this inspection by using the combine items sampling method. The Client understands that under this inspection method the statistical techniques that would otherwise be the most appropriate for this particular inspection as under the applicable single item sampling method will be substantially compromised, hence the chance of failing to identify quality and other problems in the inspected goods is greater than that when using the single item sampling method. In view of that, the Client and Intertek hereby expressly agree that Intertek shall be exempted from all and any liability caused by or arising from using the combine items sampling method including liabilities to any party for any decision or reliance concerning the acceptance, payment authorization or shipment of the inspected goods and the Client will hold Intertek harmless against any loss and damages as a result of so doing."

THE RESULTS REFLECT OUR FINDINGS AT TIME AND PLACE OF INSPECTION. THIS REPORT DOES NOT RELIEVE SELLERS/MANUFACTURERS FROM THEIR CONTRACTUAL LIABILITIES OR prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This REPORT DOES NOT EVIDENCE SHIPMENT.





NUMBER: SHIJ894611 (1ST REVISED) THIS IS TO SUPERSEDE REPORT SHIJ894611 DATED SEP 10, 2020

The inspection results of the above mentioned merchandise were found as follows:

INSPECTION CRITERIA	<u>* RESULT</u>
A) QUANTITY AVAILABLE	CONFORMED
B) PRODUCT DESCRIPTION, STYLE AND COLOUR	NOT CONFORMED, REFER TO SPECIAL ATTENTION
	POINT 1
C) WORKMANSHIP	CONFORMED
D) DATA MEASUREMENT/CHECKING	NOT CONFORMED, REFER TO SPECIAL ATTENTION
	POINT 2,3,4
E) PACKAGING	NOT CONFORMED, REFER TO SPECIAL ATTENTION
	POINT 5,6,7
F) SHIPPING MARK	CONFORMED

SUMMARY RESULT		CRITICAL	MAJOR	MINOR
WORKMANSHIP	NUMBER OF DEFECT ALLOWED:	0	5	7
	TOTAL:	0	0	5

OVERALL INSPECTION RESULT : **NOT CONFORMED**

to applicant's requirement.

Please advise your comment on the inspection findings.



NUMBER: SHIJ894611 (1ST REVISED) THIS IS TO SUPERSEDE REPORT SHIJ894611 DATED SEP 10, 2020

SPECIAL ATTENTION

1. Product description, style and colour check

A.For item#108639,the shape of board "15" was found different with that printed on instruction manual. B.For item#108639,the shape of screw "R", "W" were found different with that printed on instruction manual; For item#108640,the shape of screw "W" was found different with that printed on instruction manual.

Master carton gross weight for item#108640(out of tolerance +/-5%)
 -printed on master carton and specification:6.1kg

-actual finding:6.8kg,6.8kg

3. Product size check for item#108640(out of tolerance +/-5%)

	Required	Actual finding
Plastic feet	Will rise 6cm	Will rise 6.8cm for all 5 samples
Two hating plate	diameter 7.5cm	diameter 9.8cm for all 5 samples
Screw "C"	4x16mm	4x19mm for all 5 samples

4. Barcode scanning check on service card and instruction manual for all items -after QR code scanning, the information could not be showed completely on mobile phone.

5. Packing deviation for item#108639

-required:plastic parts and light should be packing together.
-actual finding:the plastic parts and light were not packed together.the plastic parts were packed into two poly-bags, however,the light was packed into a white box then packed into a inner carton.

6. For item#108639 the rating label was found printed on a white paper however it was required printed on a silver.

- 6. For item#108639, the rating label was found printed on a white paper, however, it was required printed on a silver film paper.
- Age warning symbol deviation for all items

 A.-required:the circle and the stroke was red
 -actual finding:the color of age warning symbol printed on master carton and labels was black
 B.-required:diameter at least 10mm

-actual finding:8mm for sticker for all items;6 mm for rating label for item#108639



NUMBER: SHIJ894611 (1ST REVISED) THIS IS TO SUPERSEDE REPORT SHIJ894611 DATED SEP 10, 2020

 INSPECTION REQUIREMENT
 :
 FINAL RANDOM INSPECTION

 INSPECTION STANDARD ADOPTED:
 ANSI/ASQC Z1.4

 SINGLE SAMPLING PLAN FOR NORMAL INSPECTION GENERAL INSPECTION LEVEL II

 ACCEPTABLE QUALITY LEVEL (AQL) FOR:

 CRITICAL NONCONFORMITY (DEFECTIVE)
 :
 Not Allowed

 MAJOR NONCONFORMITY (DEFECTIVE)
 :
 1.5

 MINOR NONCONFORMITY (DEFECTIVE)
 :
 2.5

INSPECTION RESULTS:

THE INSPECTION RESULTS WERE FOUND AS FOLLOWS:

A) QUANTITY AVAILABLE:

	ORDER QUANTITY	REQUESTED INSPECTION QUANTITY	LOT SIZE	ACTUAL AVAILABLE QUANTITY (SHIPMENT)		QUANTITY FINISHED		SAMPLIN	G SIZE FROM
				PACKED	NOT PACKED		PACKED QUANTIT Y	NOT PACKED QUANTITY	
NO. OF PIECE	2,750	2,750	2,750	2,750	0	0	125	0	
NO. OF CARTON	2,750	2,750	2,750	2,750	0	0	125		

NOTE:

- 1. CARTON SELECTED FOR SAMPLING : CARTON
 - : CARTON NO. WAS NOT ASSIGNED YET.

B) <u>PRODUCT DESCRIPTION, STYLE AND COLOUR</u>:

CHECK AGAINST P.O./SPECIFICATION PROVIDED BY CLIENT - The inspected samples were found similar to the description of PO/specification. NO SUBMITTED SAMPLE WAS PROVIDED BY APPLICANT OR SUPPLIER FOR STYLE & COLOUR COMPARISON CHECK AGAINST THE INSTRUCTION MANUAL SUBMITTED BY CLIENT

- Discrepancy was found on the Instruction Manual. Please refer to Special Attention point 1

INSPECTION RESULTS:

			THIS IS TO S	SUPERSEDE	E REPOR				4611 (1st re Dated sep		020
INSPI	ECTION F	RESULTS:									
C)	WORK	MANSHIP:									
	DETAIL	S OF NONCO	NFORMITY (DEFECTIVES):		CI	RITICAL	MA	IOR	MINOR		
	For iter	n#108639(sa	mple size:50 pieces)								
		mark(3.5cm				0	0)	1		
	smear	printing(0.7cl	m) on unit			0	0)	1		
	For iter	m#108640(sa	mple size:75 pieces)								
	dirty m	ark(3-8cm) o	n unit			0	0)	2		
	incomp	lete printing	(1cm) on unit			0	C)	1		
			AC	TUAL FINDIN	NG:	0	0)	5		
				ALLOW	ED:	0	5	;	7		
D)		AEASI IREMEN	NT/CHECKING:								
0)		Assembly ch		(5	Samples	(itom)	· Sati	isfact	ony		
	2)	-	code, check scanned No. to	(5)							
	2)		rinted No. on the barcode.	(J	Jampies	syntemy			Attention poi		
		-	he barcode No. to match with				She		strention po	1111 4	
		the requiren									
	3)	Quantity che		(2	cartons/	(itom)	: Sati	isfact	on		
	3) 4)	Basic operat		(125	samples	-		isfact	-		
	4) 5)	-	d performance check	(125	samples	-		isfact	•		
	5) 6)	Product mea	-	(5)	samples	-			formed, refe	r to	
	0)	Product mea	isurement	(5	samples	(item)					
		Itom No	Dreduct size (weight stated on	Actual fin	adin a news				Attention poi	int 5	
		Item No.	Product size/weight stated on specification	Actual fir	nding pro	uuct size	/weight	L			
			Product size: 91.5X32.5X88cm	Products	size: 01 5	¥32¥88c	m for al	15 52	mples(with f	eet)	
			Product weight:14.8kg						mples(witho		
				feet)	5120. 51.5	N32N020		1550	inpics(witho	ut	
					weight:14	1 75kg 1/	l 75ka 1	4 75	kσ		
		108639			4.8kg(wit				<u>~Б</u> /		
		100033	Product size: 57x30x83cm	-			-		amples(with		
			Product size: 57x30x83cm Product weight:5.2kg			.9.3888.8		ali 5 9	ampies(with		
			plastic fe		0 5,00		East	malac/+k -	+		
						.9.3x82Cl	ii ior all	5 SG	mples(witho	ui	
				plastic fe		2ka E 2k	~ г о	г эн	_		
		1000.40			weight:5.			כ.3K))/		
		108640	5.2kg(without plastic parts)								

InterviewShangHai Orient Intertek Testing Service - INSPECTIONInterviewDIRECT FAX NO.: (86-21) 53397745TEL. NO.: (86-21) 53397600

TO :DEUBA BMBH & CO KG - MARGARITA WANG/KRAUS/ALINA LI/DANIEL BEHRENS/UDO SCHAFER C.C. :INTERTEK CONSUMER GOODS GMBH - GREY BAXTER

NUMBER: SHIJ894611 (1ST REVISED) THIS IS TO SUPERSEDE REPORT SHIJ894611 DATED SEP 10, 2020

7)	Carton dimensio	on check	(2	cartons/item)	:	Satisfactory				
	ltem No.	Master carton size									
	108639	100.5x16.5x36cm;1	100.5x16.5x36cm;100.5x16.5x36cm								
	108640	84x12x36.5cm;84x2	L2x36.5	Scm							
8)	Carton gross we	ight check	Not conformed, refer to Special Attention point 2								
	ltem No.	Master carton gross	s weigł	nt							
	108639	16.75kg;16.75kg									
	108640	6.8kg;6.8kg									
9)		y compartment fitting check (2 samples/item) : Satisfactory									
10)	Battery reverse	check	(2	samples/item)	:	Satisfactory				
11) Moisture content check on wooden (5 Samples/item) part/wooden component					:	Satisfactory					
	ltem No.	Moisture content									
	108639	9%,9%,11%,9%,10%	0								
	108640	13%,13%,13%,13%,	12%								
12)	3 M tape check		(2	Samples/item)	:	Satisfactory				
13)	Stability check		(2	Samples/item)	:	Satisfactory				
14)	Transportation of carton	drop check on master	(1	carton/item)	:	Satisfactory				

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or presudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.





NUMBER: SHIJ894611 (1ST REVISED) THIS IS TO SUPERSEDE REPORT SHIJ894611 DATED SEP 10, 2020

INSPECTION RESULTS:

- E) FORM OF PACKAGING:
 - For all items

Each set with manual, service card and accessories were packed into a master carton, then sealed with gummed tapes.


Discrepancy was found, refer to Special Attention point 5,6,7

F) <u>SHIPPING MARKS:</u>



The results replect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



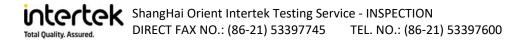

NUMBER: SHIJ894611 (1ST REVISED) THIS IS TO SUPERSEDE REPORT SHIJ894611 DATED SEP 10, 2020

NOTE

1. The breakdown quantity per each PO/item was shown as below:

Item	PO quantity (PCS/CTN)	Actual quantity (PCS/CTN)	Sample size (PCS/CTN)
108639	1100/1100	1100/1100	50/50
108640	1650/1650	1650/1650	75/75
T	Total:		125/125

2. The factory refused to seal defect samples and production samples on spot.

For avoid mould growth on product or packaging material, client is recommended to require vendor / factory / logistic service provider / store managers, to well control the storage condition and shipping condition for avoid any damage to products. Moisture content and humidity of the manufacturing plant should be measured and assessed, including monitoring of packaging materials, general housekeeping, etc. The moisture prevention procedure should also be implemented in shipment, transportation and finished products handling in distribution center and store.

AUTHORIZED BY: atrick Shou PATRICK ZHOU

PATRICK ZHOU GENERAL MANAGER INSPECTION DIVISION CHINA



Total Quality. Assured.


For 108639

NUMBER: SHIJ894611


PHOTO ATTACHMENT



01 defect-minor-scratch mark(3.5cm) on unit

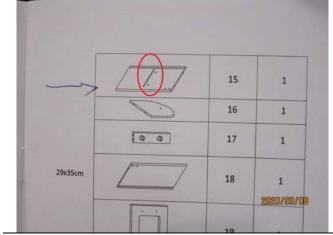

03 special attention 1-a-stated on instruction manual

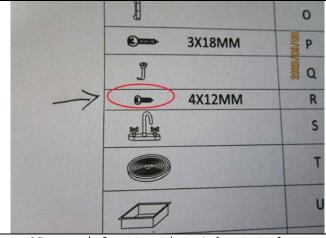

05 special attention 1-b-stated on instruction manual



02 defect-minor-smear printing(0.7cm) on unit



04 special attention 1-a-actual finding



06 special attention 1-b-actual finding



Total Quality. Assured.

NUMBER: SHIJ894611



38 special attention 5-stated of specification



9 special attention 5-actual finding (2)



09 special attention 5-actual finding
(3)



INSPECTION REPORT Total Quality, Assured

NUMBER: SHIJ894611



11 lot storage (3)

11 master carton



intertek INSPECTION REPORT

Total Quality. Assured.

NUMBER: SHIJ894611





intertek INSPECTION REPORT

Total Quality. Assured.

NUMBER: SHIJ894611






NUMBER: SHIJ894611





Total Quality. Assured.

NUMBER: SHIJ894611

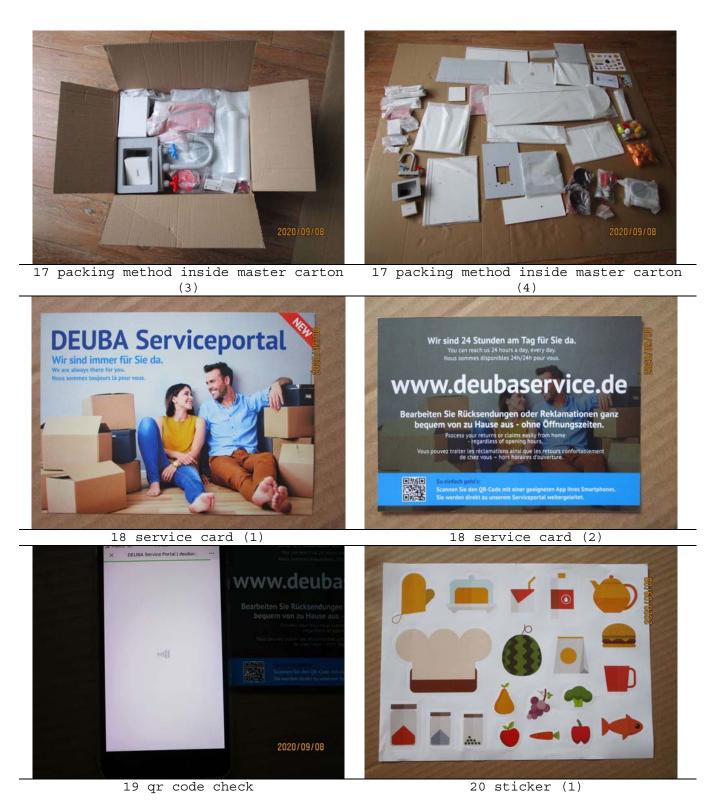



NUMBER: SHIJ894611




21 instruction manual (04)

21 instruction manual (05)




NUMBER: SHIJ894611

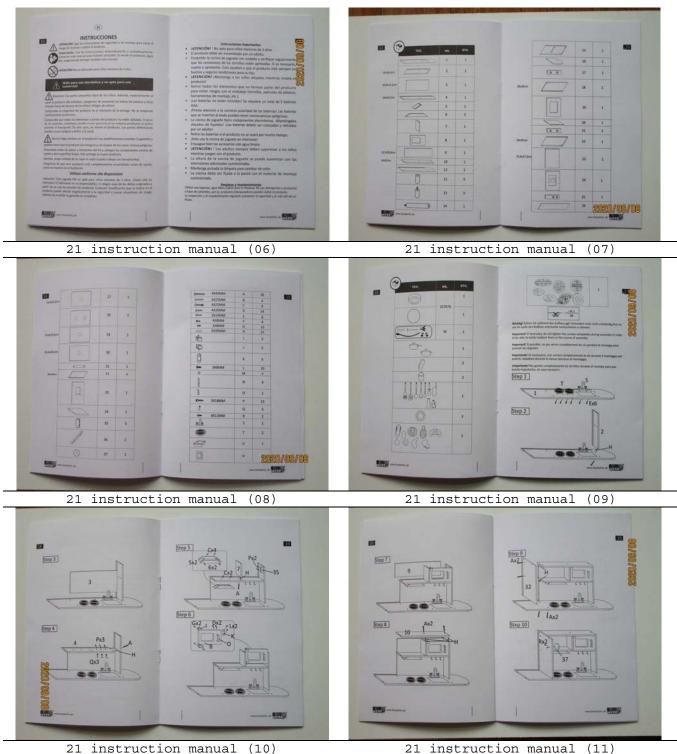

21 instruction manual (11)




NUMBER: SHIJ894611

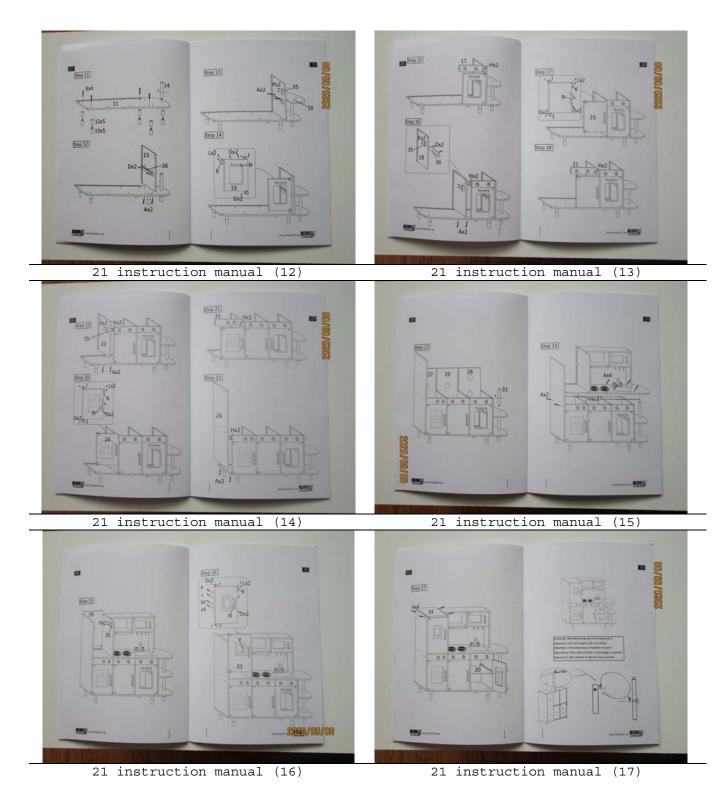

Total Quality. Assured.

NUMBER: SHIJ894611

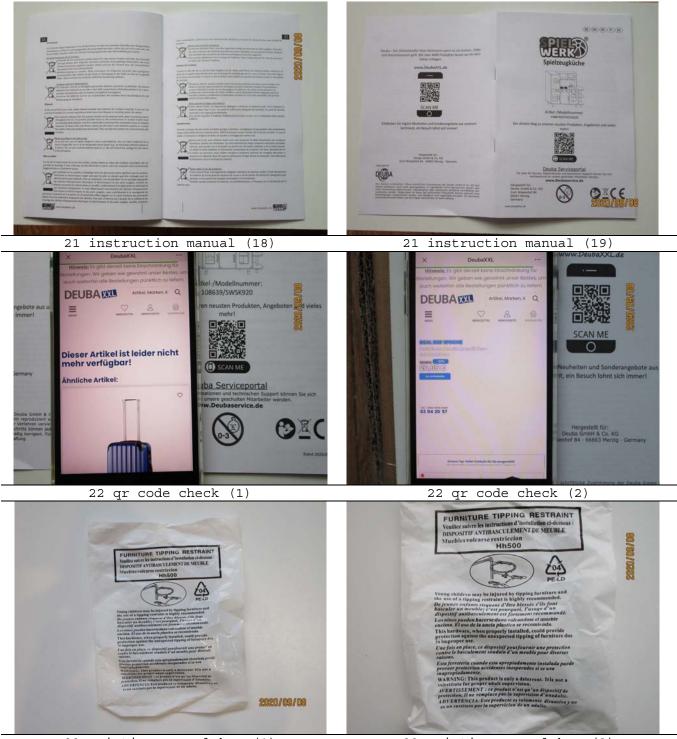

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

23 printing on polybag (2)

23 printing on polybag (1)



Total Quality. Assured.

NUMBER: SHIJ894611



Total Quality. Assured.

NUMBER: SHIJ894611



26 product details view (01)



26 product details view (02)




26 product details view (03)



26 product details view (04)



26 product details view (06)

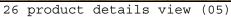



Total Quality. Assured.

NUMBER: SHIJ894611



26 product details view (11)

26 product details view (12)



Total Quality. Assured.

NUMBER: SHIJ894611





NUMBER: SHIJ894611



31 3m tape check (2)

32 stability check



NUMBER: SHIJ894611



34 carton drop check



Total Quality. Assured.

For 108640

NUMBER: SHIJ894611





Total Quality. Assured.


NUMBER: SHIJ894611






Total Quality. Assured.

NUMBER: SHIJ894611

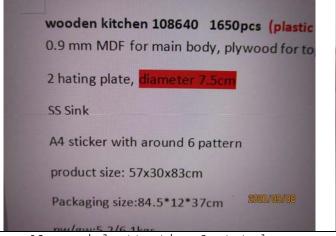

08 special attention 3-stated on specification

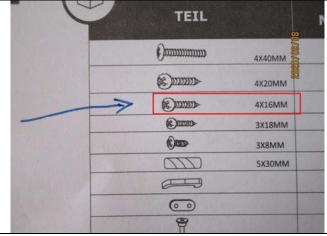

10 special attention 3-stated on instruction manual



for age warning symbol size



09 special attention 3-actual finding



11 special attention 3- actual finding



13 master carton



Total Quality. Assured.

NUMBER: SHIJ894611





intertek INSPECTION REPORT

Total Quality Ass

NUMBER: SHIJ894611



13 printing on master carton (11)



INTERLEK INSPECTION REPORT

Total Quality. Assured


NUMBER: SHIJ894611






Total Quality. Assured.

NUMBER: SHIJ894611

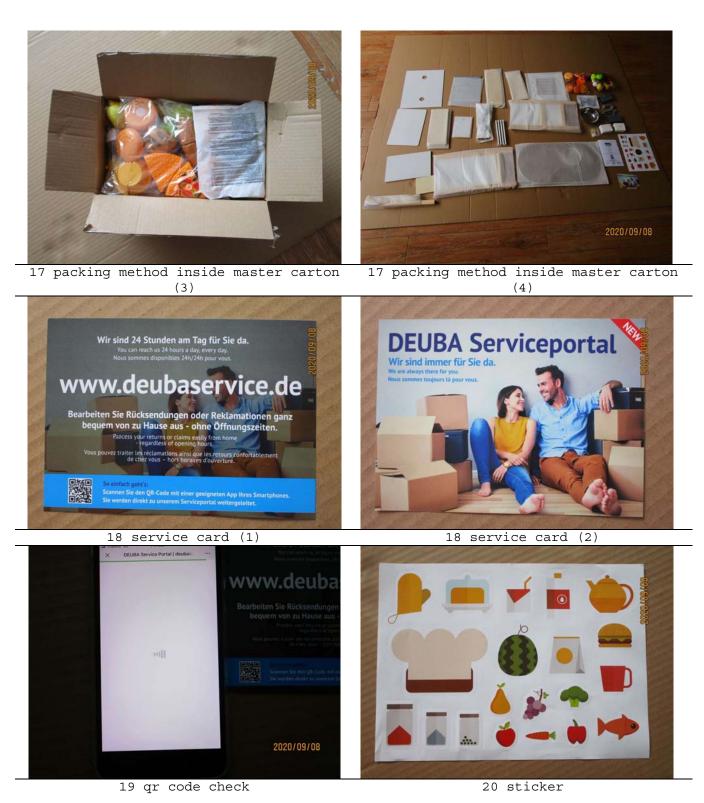




NUMBER: SHIJ894611

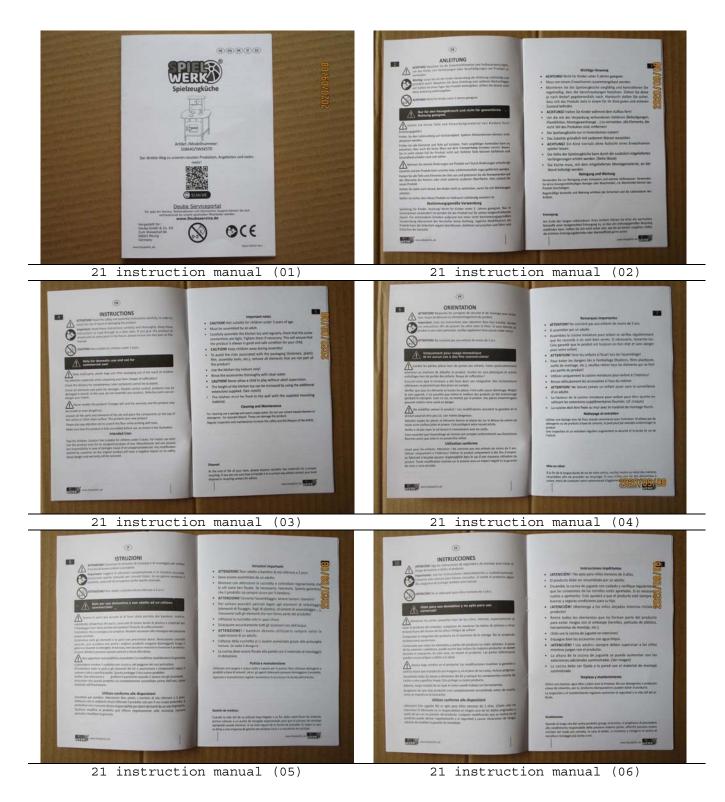



NUMBER: SHIJ894611

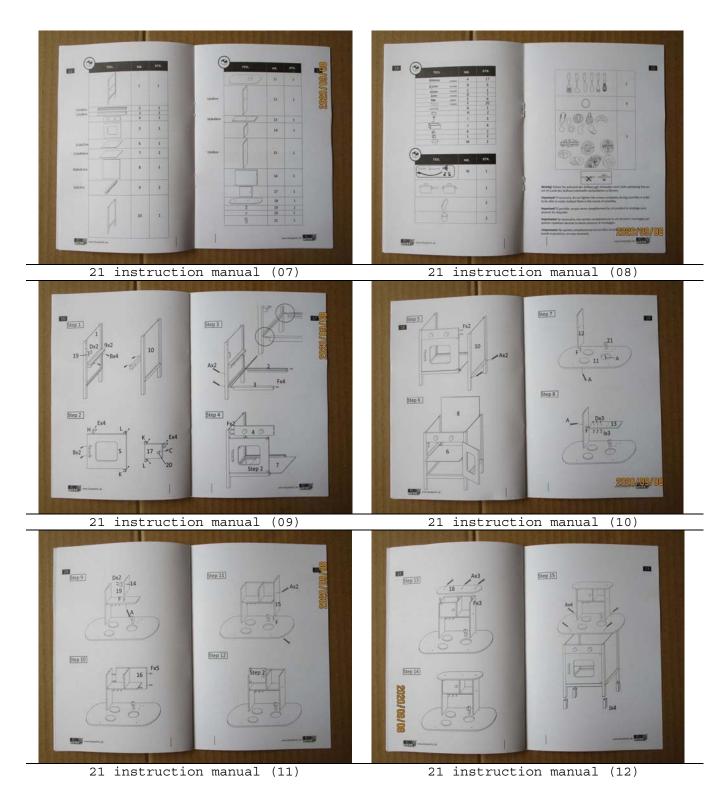




intertek INSPECTION REPORT

Total Quality. Assured.

NUMBER: SHIJ894611

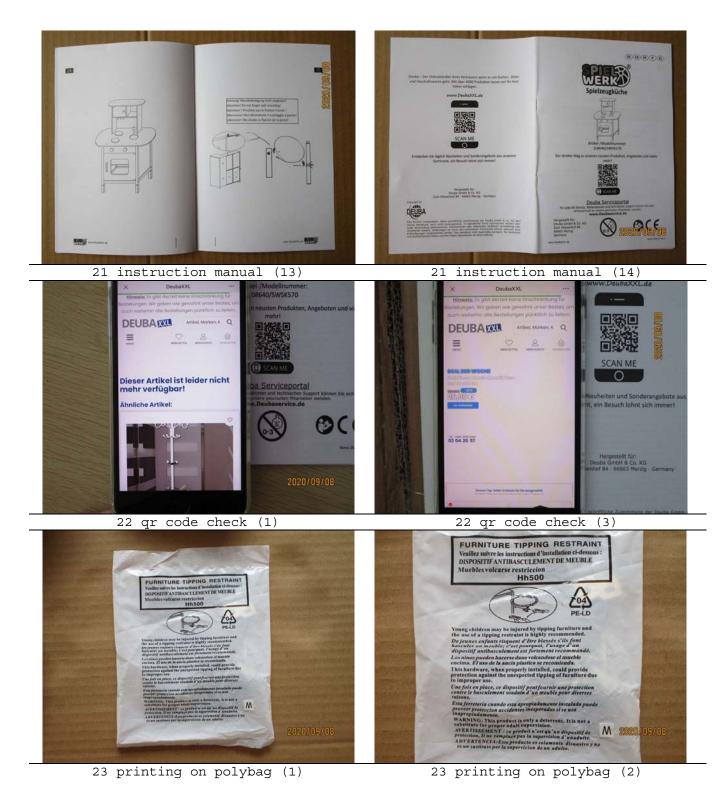

Total Quality. Assured.

NUMBER: SHIJ894611



26 product details view (01)

26 product details view (02)



NUMBER: SHIJ894611



NUMBER: SHIJ894611



The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

27 qr code check

28 battery compartment fitting check



NUMBER: SHIJ894611



31 stability check

32 application check (1)

Page 39 of 40

NUMBER: SHIJ894611



32 application check (2)

33 carton drop check